





**WARRANTY:** CK Worldwide, Inc. warrants products manufactured by CK Worldwide, Inc. to be free of defects in materials and workmanship. CK Worldwide, Inc. limits this warranty to replacement of the product or parts thereof and excludes liability for injury, property damage or economic loss attributable to product use or misuse. In any event, CK Worldwide, Inc. will only be responsible for its products when used with accessory items manufactured by CK Worldwide, Inc.

**INSTALLATION:** Before using this torch, - tighten regulator, hose and power cable fittings with proper wrenches. Using small pliers, securely tighten all knurled hose fittings (Slide the torch handle back for access to the torch connections). Purge the regulator and TIG torch with inert gas at 20 cubic feet per hour. Following these steps will ensure contamination free welds. Repeat this procedure whenever torch or regulator fittings have been detached.

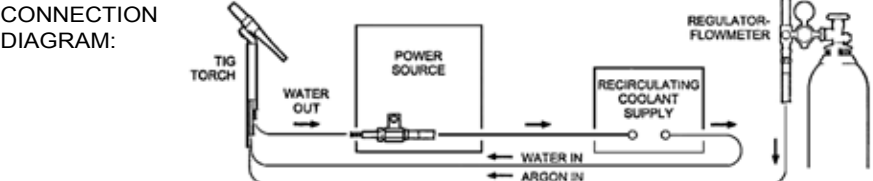

**INFORMATION CHART:**

Electrode Diameter in inches (mm)	Cup Size	WELDING CURRENT (AMPS) - TUNGSTEN TYPE				ARGON FLOW - FERROUS METALS		ARGON FLOW - ALUMINUM	
		AC Pure	AC Thoriated	DCSP Pure	DCSP Thoriated	Standard Body (Liters)	Gas Lens Body (Liters)	Standard Body (Liters)	Gas Lens Body (Liters)
.020 (0.50)	4 or 5	5 - 15	5 - 20	5 - 15	5 - 20	5-8 (3-4)	5-8 (3-4)	5-8 (3-4)	5-8 (3-4)
.040 (1.00)	4 or 5	10 - 60	15-80	15 - 70	20 - 80	5-10 (3-5)	5-8 (3-4)	5-12 (3-6)	5-10 (3-5)
1/16 (1.60)	4, 5 or 6	50 - 100	70 - 150	70 - 130	80 - 150	7-12 (4-6)	5-10 (3-5)	8-15 (4-7)	7-12 (4-6)
3/32 (2.40)	6, 7 or 8	100 - 160	140 - 235	150 - 220	150 - 250	10-15 (5-7)	8-10 (4-5)	10-20 (5-10)	10-15 (5-7)
1/8 (3.20)	7, 8 or 10	150 - 210	220 - 325	220 - 330	240 - 350	10-18 (5-9)	8-12 (4-6)	12-25 (6-12)	10-20 (5-10)
5/32 (4.00)	8 or 10	200 - 275	300 - 425	375 - 475	400 - 500	15-25 (7-12)	10-15 (5-7)	15-30 (7-14)	12-25 (6-12)
3/16 (4.80)	8 or 10	250 - 350	400 - 525	475-800	475-800	20-35 (10-17)	12-25 (6-12)	25-40 (12-19)	15-30 (7-14)
1/4 (6.40)	10	325 - 700	500 - 700	750 - 1000	700 - 1100	25-50 (12-24)	20-35 (10-17)	30-55 (14-26)	25-45 (12-21)

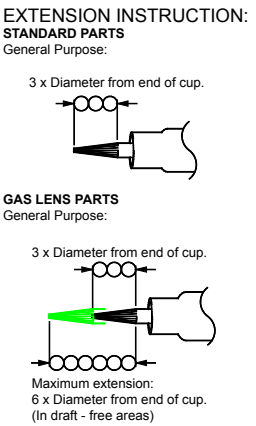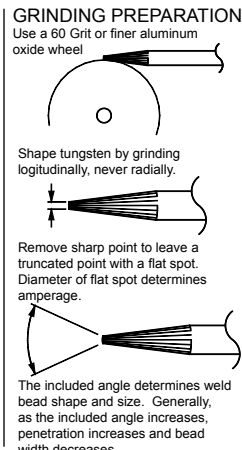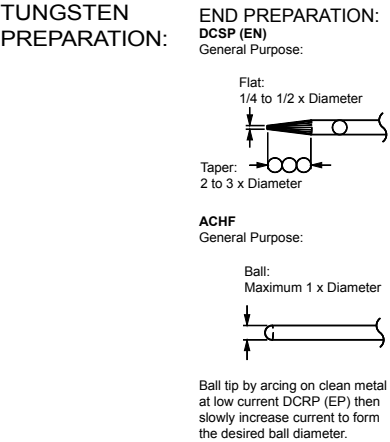

**CAUTION:** Personal harm will result from touching the hot parts of a TIG torch without insulative protection, or from looking directly or indirectly at an arc or reflected arc. At no time should bare skin be exposed to a welding arc.



TIG TORCH MANUAL



CK18 & CK18V RIGID

TECHNICAL INFORMATION

RATING @ 100% DUTY CYCLE: 350 AMP ACHF OR DCSP  
COOLING METHOD: WATER COOLED



ACCESSORY ITEMS REQUIRED FOR COMPLETE INSTALLATION:

HEAD ACCESSORIES: 3 SERIES HEAD ACCESSORIES  
POWER CABLE ADAPTOR: 45V11 (2PCA)

MODEL SELECTOR - TORCH PACKAGES

HEAD STYLE	CABLE STYLE	CABLE LENGTH	STANDARD CABLE	SUPERFLEX CABLE
Rigid Head - w/o valve	3 Piece	12-1/2 ft. (3.8 m)	CK18-12	CK18-12SF
		25 ft. (7.6 m)	CK18-25	CK18-25SF
Rigid Head - w/ valve	3 Piece	12-1/2 ft. (3.8 m)	CK18V-12	CK18V-12SF
		25 ft. (7.6 m)	CK18V-25	CK18V-25SF

**IMPORTANT !!**  
**READ AND UNDERSTAND THE**  
**INFORMATION CONTAINED IN THIS**  
**MANUAL BEFORE OPERATING THE EQUIPMENT !**

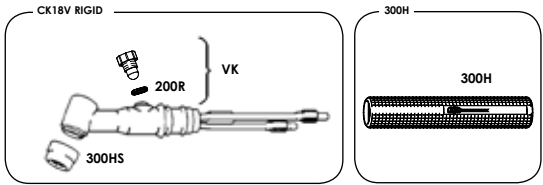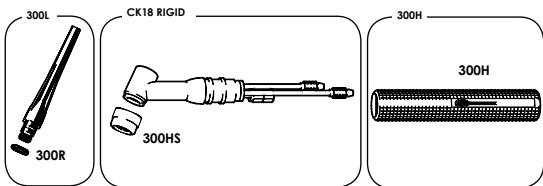

PART #	DESCRIPTION
--------	-------------

**TORCH**

CK18 RIGID..... TORCH BODY ASSEMBLY  
CK18V RIGID..... TORCH BODY VALVED  
300H..... HANDLE


**INDIVIDUAL CABLE, HOSES/FITTINGS INCLUDED)**

VK..... GAS VALVE  
40V74..... GAS HOSE-12-1/2 FT.  
40V74SF..... GAS HOSE-12-1/2 FT. (SUPER-FLEX)  
40V64..... POWER CABLE-12-1/2 FT.  
40V64SF..... POWER CABLE-12-1/2 FT. (SUPER-FLEX)  
41V29..... POWER CABLE-25 FT.  
41V29SF..... POWER CABLE-25 FT. (SUPER-FLEX)  
40V75..... WATER HOSE-12-1/2 FT.  
40V75SF..... WATER HOSE-12-1/2 FT. (SUPER-FLEX)  
41V32..... WATER HOSE-25 FT.  
41V32SF..... WATER HOSE-25 FT. (SUPER-FLEX)  
41V30..... GAS HOSE-25 FT.  
41V30SF..... GAS HOSE-25 FT. (SUPER-FLEX)


**ACCESSORIES**

2PCA (45V11)..... POWER CABLE ADAPTER (ORDER SEPARATELY)  
SLWHAT-T..... TWECO POWER CABLE ADAPTER (SAFE-LOC)  
SLWHAT-25..... DINSE 25 POWER CABLE ADAPTER (SAFE-LOC)  
SLWHAT-35..... DINSE 35 POWER CABLE ADAPTER (SAFE-LOC)  
SLWHAT-35M..... DINSE 35 FLOW-THRU GAS POWER CABLE ADAPTER (SAFE-LOC)


300R..... O-RING  
300HS..... HEATSHIELD  
300L..... BACKCAP  
2AN..... GAS NUT  
2WN..... WATER NUT  
3HF..... HOSE FITTING  
3PF1..... POWER CABLE FITTING  
3PF2..... POWER CABLE FITTING

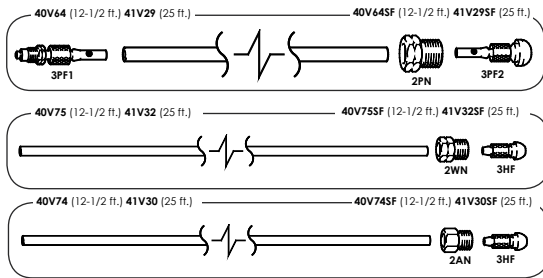

**3 SERIES HEAD ACCESSORIES GAS SAVER**

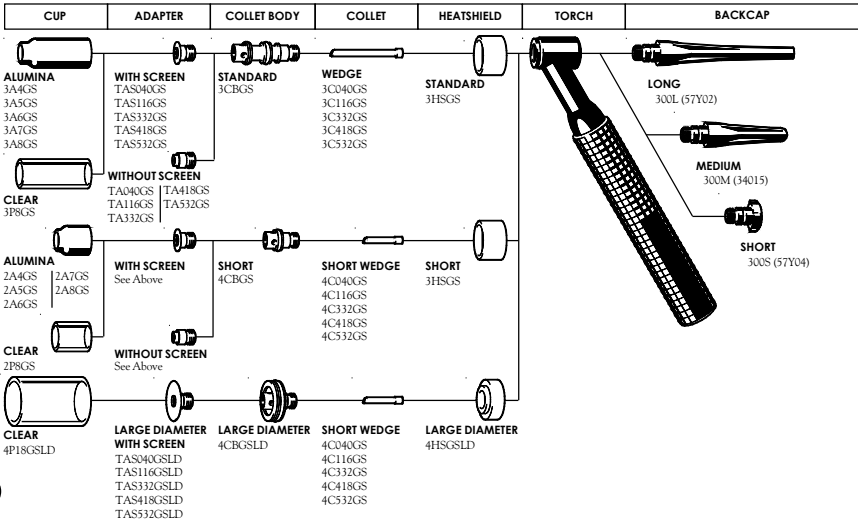

**3 SERIES HEAD ACCESSORIES**

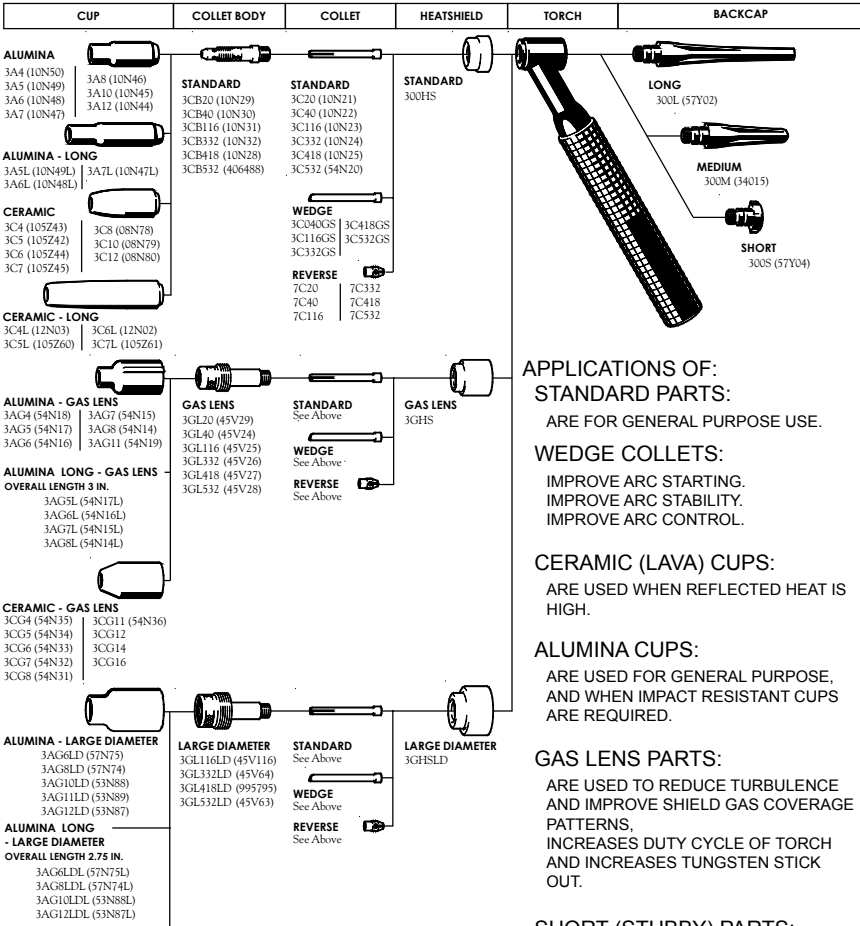

TUNGSTEN ELECTRODE CONVERSION CHART		
Size Suffix	Inches	Millimeters
020	.020"	.5mm
040	.040"	1.0mm
116	1/16"	1.6mm
332	3/32"	2.4mm
418	1/8"	3.2mm
532	5/32"	4.0mm

**APPLICATIONS OF: STANDARD PARTS:**

ARE FOR GENERAL PURPOSE USE.

**WEDGE COLLETS:**

IMPROVE ARC STARTING.  
IMPROVE ARC STABILITY.  
IMPROVE ARC CONTROL.

**CERAMIC (LAVA) CUPS:**

ARE USED WHEN REFLECTED HEAT IS HIGH.

**ALUMINA CUPS:**

ARE USED FOR GENERAL PURPOSE,  
AND WHEN IMPACT RESISTANT CUPS  
ARE REQUIRED.

**GAS LENS PARTS:**

ARE USED TO REDUCE TURBULENCE  
AND IMPROVE SHIELD GAS COVERAGE  
PATTERNS,  
INCREASES DUTY CYCLE OF TORCH  
AND INCREASES TUNGSTEN STICK  
OUT.

**SHORT (STUBBY) PARTS:**

ARE USED TO SHORTEN THE OVERALL  
LENGTH OF THE TORCH HEAD.  
REDUCES DUTY CYCLE OF TORCH

**GAS SAVER® PARTS:**

ARE USED TO SAVE UP TO 40% ON GAS  
CONSUMPTION.  
ARE USED TO SAVE UP TO 60% ON  
CONSUMABLE PARTS.  
ARE USED TO CLEARLY SEE THE WELD  
PUDDLE.  
ARE USED TO ACHIEVE GAS LENS